

TiO Software Suite Release Notes

July 7, 2015

Element Software Version Numbers

Software Suite Version: 2.02

Includes:

MC Version:	2.02
Audio Version:	3.00
Lighting Version	1.18
Android App Version:	2.0.2
iPad App Version	2.00

To see the current software versions of the Elements in your system, access the "Manage Your Elements" page from the Main Settings page in the TiO Pro app. All Elements will be listed and the version for each is shown.

All TiO Home application updates are obtained by downloading the new version of the app from the Google Play Store or the Apple Store.

A user can check for available TiO Element updates via the TiO app by navigating to the settings page and selecting "Check for Updates". If an update is available for one or more TiO Elements an option to apply the updates will be presented. Selecting to apply the updates will update the MC, which will subsequently update any other TiO Elements that are paired with the MC.

If an MC update is available, the MC will update first, then restart. This will cause all paired Elements to disconnect and reconnect. Updates will then be applied to the Elements. Updating all Elements could take up to twenty minutes depending on the size of the system.

Updating a currently configured system will not change any of the configuration settings. All Element and Space names and Moods and Experiences are persistent through the update process.

New Features in Software Suite 2.0.2

1. Improved Audio Support
 - a. Improved menu and button response
 - b. Improved Bluetooth operation –
 - i. Switching between multiple Bluetooth sources now as simple as selecting the new device.
 - ii. Album art now properly displayed
 - iii. List/Forget options now function correctly
 - c. Improved stability and reliability of audio streamer
 - i. Removal of Stand-alone mode
 - ii. Numerous improvements in software back end
 - d. Streamshare dialog buttons now function properly
 - e. Mood capture improved
 - i. Volume level now saved with Mood so that activating a Mood restores the desired audio level
 - ii. Reliability of Mood activation improved significantly – audio in Moods now works reliably
 - f. Other bug fixes to improve overall speed, responsiveness and reliability
2. Master Coordinator Improvements
 - a. MC2 required
 - b. Action Group reliability improved – a bug that would cause erratic action group behavior after an MC reset has been fixed.

Known Issues in Software Suite 2.0.2

General

1. Required MC Upgrade

This software version will operate on Master Coordinator MC2 only.

Audio

1. Press and Hold when Volume Assigned to button on (M)TL4

Volume must be raised and/or lowered via multiple button presses. Each press and release will raise or lower the volume 5%.

2. StreamShare

Go solo screen does not appear on the first instance

3. EQ Settings are not yet functional

4. List of Bluetooth device may occasionally be out of sync with actual connections.

5. Selecting the Optical Input may display a spinning wheel while audio is playing

6. Shadows/Clones

The Go Solo screen does not immediately appear when a clone is made. The app must be restarted for the Go Solo option to appear.

The volume of a clone is not automatically set when the clone is made. The volume level must be set manually. Shadows and Clones may not be set every time and may require setting twice to save properly.

7. UPnP

Working on TiO network only. Does not bridge from home owner's network. Album art will display if the cover image is stored in the same folder as the music and named cover.jpg.

8. Rhapsody

Rhapsody recently changed the way streaming systems work with their service. Rhapsody may not appear as an option on your system.

9. Sirius XM

Input of Sirius XM accounts is not supported.

Lighting

1. Update procedure sometimes fails

The TL4 will automatically retry the update in 5 minutes. If the update fails 3 or more times, activate the Air Gap to power cycle the processor in the TL4.

2. TL4 Sometimes has difficulty pairing to a new MC

Pairing with a new MC when the TL4 has been previously paired with a different MC, may require manual activation of the Pairing Mode. Hold both top and bottom buttons for approximately 5 seconds until a double click is heard. After about a minute, the backlight will begin pulsing quickly, indicating that the TL4 is in Pairing Mode. Please follow the automatic association process to pair the TL4 to the new MC.

3. TL4 sometimes loses connection to a previously Paired MC

The TL4 will automatically continue to attempt to reconnect to the MC. If this takes more than 15 minutes, activate the air gap to reboot the TL4.

Climate

1. Climate Display Refresh

When interfacing with a Nest Thermostat, the inside temperature and Humidity displays are updated every 90 seconds.

2. No beacon support for Nest Thermostats

TiO cannot beacon a Nest Thermostat from the Manage Elements screen.

System Setup

1. Automated Pairing

When the tablet running the TiO Pro app is connected directly to the MC (rather than the user's network, which is the preferred method) saving the identified Elements will cause the tablet to disconnect from the MC when the MC radio resets. This will require a shutdown and restart of the TiO Pro app. When connected to the user's network, the TiO Pro connection to the MC is automatically restored.

2. System Registration

Functionality is currently hidden

3. Installer Registration/ Lookup

Functionality is currently hidden